

CTL
EMU CRITICAL ITEMS LISTPage: 1
Date: 11/18/94

12/24/94 SUPERSEDES 12/26/92

ANALYST:

NAME	P/N	CRT	FAILURE MODE & CAUSES	FAILURE EFFECT	RATIONALE FOR ACCEPTANCE
POWER MODE SELECTOR SWITCH, ITEM 364	364PH04:	2/2	Power mode switch falls in (battery power) position. (12)	END ITEM: Switch remains in battery position when toggle placed in SCU position.	A. Design - Each of three switches is sealed in a dry nitrogen filled hermetically sealed case. The switches are per MIL-S-8805/46 with the 10 amp contacts are silver plated. Switch contacts rated for 10 ampera. Actual current flow is 3.8 ampera. The handle is designed to withstand a toggle force of 25 lbs. without degradation in subsequent performance. The ball socket of the toggle pivot is greased (Braycote 601) prior to assembly. Microswitch actuator overtravel is adjusted to .007 inch minimum to ensure the common contact arm rotates completely over to the normally open contact.
SV778596-4 (1)			CAUSE: Contact welding caused by arcing or by exposure to vacuum, damage to switch actuator lever.	GFE INTERFACE: Battery always supplies electrical power to radio regardless of power mode switch position. CLIV (171) and SW Valve also powered from battery only.	B. Test - Component Acceptance Test - Switch operation and continuity are verified during vendor acceptance tests. The switch is also subjected to 500 run-in cycles and an axial pull test on the handle to verify that it will not come loose during normal use. In-Process Test - Operation and integrity of the switch are verified during four separate In-process tests during initial item 350 assembly. These tests include continuity and output voltage. The switch is cycled during these tests. PQA Test - The switch is subjected to Acceptance/PQA testing as part of Item 350. Tests include continuity, operating torque, vibration, thermal cycling, and thermal vacuum. The switch is also cycled during Item 350 Acceptance/PQA electrical functional tests. Certification Test - The item completed 5,464 inductive and 8,536 resistive cycles during 1/81 which satisfied the cycle certification requirement of 5,464 and 8,536 respectively. Class I Engineering Change 42005-386 (Toggle handle pull test) has been incorporated since this configuration was certified.

C. Inspection -

12/24/94 SUPERSEDES 12/24/92

ANALYST:

NAME	FAILURE	NODE & CAUSES	FAILURE EFFECT	RATIONALE FOR ACCEPTANCE
P/N				
QTY	CRIT			
	2/2	364FM04:		To preclude failure due to internal contamination, the switches are assembled by the vendor in an environmentally controlled room. Assembly and processing is per MIL-S-8805/66. The switches receive in process cycling and leak checks. The entire item 364 is x-ray inspected for acceptability of brazing.

D. Failure History -

J-EMU-300-006 (10-18-83)

The J11E flight failed to turn on upon power switchover during PIA tests. The outage was found to be caused by mechanical failure of the Power Mode Switch (364) which prevented proper power switchover. ED62806-386 added a pull test to the 364 vendor test to insure the switch togglearm would not come loose during normal use. This EC created the -2 switch configuration. Certified on 1/84 per SEMU-540.

B-EMU-300-A000 (11/19/93) - Intermittent operation of the power mode switch due to incomplete deployment of the actuator lever when the switch is in the SCU position caused by inadequate actuator lever overtravel. Overtravel is defined as the amount of travel of the actuator lever after the switch contacts transfer from the normally closed contact to the normally open contact. Per EC 163402-817, the switch actuator lever overtravel dimension has been lengthened to ensure proper deployment.

E. Ground Turnaround -

Tested per FEMU-R-001, SENU Communications Checkout.

F. Operational Use -

Crew Response - PreEVA: Trouble shoot problem, if no success, consider third EMU if available. Otherwise, EMU go for EVA prep on battery power. consider use of spare battery for in-suit battery swap prior to EVA.

PostEVA: Use other EMU to recharge batteries.

Training - Standard training covers this failure mode.

Operational Considerations - EVA checklist procedures verify hardware integrity and systems operational status prior to EVA. Flight rules define go/no go criteria related to EMU battery power.